

BRIDGE INSPECTION REPORT

Structure Number 20006 Sec 11/12, Lodi Twp Structure ID NB07
 Facility Carried Wagner Road Feature Intersected Unnamed Trib to Saline River

Bridge Length	12.5
Bridge Width	31
Appr. Roadway Width	30.5
Year Built	0
Year Recon	0

Inspector	Eric Rickert	Freq
Date	7/9/2009	24
General Condition		Poor
Current Posting		36 ton
Recommended Posting		36 ton
Scour Critical		

NBI INSPECTION

Item	Prev	Now	Comments
(1) Surface	5	5	New bit patch in NE and SE shoulders. Gap between east edge of pavt and guardrail is traffic hazard. 1 trans crack in SBD lane.
(2) Exp Jts	N	N	
(3) Joints	N	N	
(4) Railings	5	5	W back thrie beam not attached to bridge
(5) App Pav	7	7	Minor cracks starting in bituminous
(6) Deck	5	5	Too much dead load. Both fascias area spalled along top corner entire length with hairline cracks & leakage in fascia. No visible cracks in bottom of slabs.
(7) Stringer	4	4	Jack arch steel beams are rusting. Fascia channels on jack arch have holes through btm flange. Too much dead load on jack arch. No visible cracks in btm of jack arch concrete
(8) Paint	3	3	Never painted
(9) Utilities	N	N	
(10) Bearing	4	4	
(11) Abuts	5	5	1/2" wide crack in south abut with movement. Watch in future.
(12) Piers	N	N	
(13) Channel	5	3	Major debris jam at westend of bridge
(14) Culvert	N	N	

RECOMMENDATIONS

Priority	
High	Repair slope along east shoulder
Medium	Remove debris in channel, west of bridge
Low	